



Hewlett Packard
Enterprise

NimbleOS 5.3.1.100 Releases Notes

Legal Notices

Copyright © 2021 by Hewlett Packard Enterprise Development LP

Notices

The information contained herein is subject to change without notice. The only warranties for Hewlett Packard Enterprise products and services are set forth in the express warranty statements accompanying such products and services. Nothing herein should be construed as constituting an additional warranty. Hewlett Packard Enterprise shall not be liable for technical or editorial errors or omissions contained herein.

Confidential computer software. Valid license from Hewlett Packard Enterprise required for possession, use, or copying. Consistent with FAR 12.211 and 12.212, Commercial Computer Software, Computer Software Documentation, and Technical Data for Commercial Items are licensed to the U.S. Government under vendor's standard commercial license.

Links to third-party websites take you outside the Hewlett Packard Enterprise website. Hewlett Packard Enterprise has no control over and is not responsible for information outside the Hewlett Packard Enterprise website.

Acknowledgments

Intel®, Itanium®, Pentium®, Intel Inside®, and the Intel Inside logo are trademarks of Intel Corporation in the United States and other countries.

Microsoft® and Windows® are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

Adobe® and Acrobat® are trademarks of Adobe Systems Incorporated.

Java® and Oracle® are registered trademarks of Oracle and/or its affiliates.

UNIX® is a registered trademark of The Open Group.

All third-party marks are property of their respective owners.

Publication Date

Friday January 8, 2021 10:31:39

Document ID

vdc1608920921298

Support

All documentation and knowledge base articles are available on HPE InfoSight at <https://infosight.hpe.com>. To register for HPE InfoSight, click the *Create Account* link on the main page.

Email: support@nimblestorage.com

For all other general support contact information, go to <https://www.hpe.com/us/en/services/nimble-storage.html>.

Contents

NimbleOS 5.3.1.100.....	4
Important Update Note.....	4
Special Notes.....	4
New Features in 5.3.1.100.....	8
Recent Release Features.....	8
Documentation.....	10
Verified Update Paths.....	11
Known Critical Issues.....	15
Resolved Critical Issues.....	22
Resolved Issues.....	22
Known Issues.....	22

NimbleOS 5.3.1.100

Version: 5.3.1.100

Revision: Friday January 8, 2021 10:31:39

The release notes describe the major changes, fixes, and known issues for this release of the NimbleOS. They do not include all individual fixes and internal changes.

For technical support, contact HPE Nimble Storage Support at:

<mailto:support@nimblestorage.com>

877-3-NIMBLE (877-364-6253), option 2.

Important Update Note

Updating NimbleOS can involve an update to component firmware on the standby controller. This can cause an email alert and automated case indicating "Standby Controller Not Available" when the firmware update process takes longer than five minutes. This is expected behavior and does not affect data services. At the end of the software update, you can check status of both controllers in the Web UI under **Manage > Hardware**. One controller will be ACTIVE and the other STANDBY under normal operating conditions following a successful software update.

All third-party software notices can be found on HPE InfoSight (<https://infosight.hpe.com>) on the **Resources > Documentation** page:

<https://infosight.hpe.com/resources/nimble/docs>

The Documentation page also includes the *General Terms and Conditions* document. You can display this document by performing the following steps:

- 1 In the navigation pane on the HPE InfoSight Documentation page, scroll through the Document Type list and select Support Policy.
- 2 In the page that appears, select General Terms and Conditions. This document opens in a browser tab.

Special Notes

Note	Description
CRITICAL	HPE Nimble Storage continues to qualify configurations between releases. The Validated Configuration Matrix provides information about validated configurations and is updated frequently. It is a good practice to check your system configuration against this online tool. The Validated Configuration Matrix tool is available on HPE InfoSight: https://infosight.hpe.com/resources/nimble/validated-configuration-matrix
CRITICAL	Arrays must be running NimbleOS 5.0.6.0 or later to update to NimbleOS 5.3.1.100.
CRITICAL	An extended data services outage may occur with MS iSCSI initiator and Intel NICs using the built-in Windows driver e1q60x64.sys (version 11.0.5.21/11.0.5.22). If you encounter this problem, please update your system to use the latest Windows driver.

Note	Description
CRITICAL	<p>A service outage may occur on Windows 2012 R2 hosts using Emulex or Broadcom Fibre Channel HBAs with firmware/driver prior to 11.2. Update the Emulex or Broadcom firmware/driver to 11.2 or later</p>
CRITICAL	<p>Due to a known Red Hat Enterprise Linux bug 1002727, while running virtualized in VMware ESX, manually rebooting the active controller in presence of heavy IOs using the reboot --controller command on a Fibre Channel array may trigger an incorrect retry initiated by RHEL guests running the following kernel versions:</p> <ul style="list-style-type: none"> • 6.4 and earlier • 6.5 without the patch • 7.0 without the patch <p>This incorrect retry logic may lead to unexpected application behavior. In these environments, we recommend the failover command instead.</p>
CRITICAL	<p>Due to a known Red Hat Enterprise Linux bug 3550561, unexpected application behavior may occur on RHEL 7.5 hosts with kernel-3.10.0-862.3.2.el7 or derivatives using Emulex FC FCoE HBAs (lpfc driver) and raw devices. To avoid this issue:</p> <ul style="list-style-type: none"> • If running RHEL 7.6, update to kernel-3.10.0-957.el7 or later. • If running RHEL 7.5z, update to kernel-3.10.0-862.25.3.el7 or later.
CRITICAL	<p>As outlined in the current Validated Configuration Matrix, HPE Nimble Storage fully supports Windows guest operating systems on Microsoft Hyper-V, including Virtual Fibre Channel (VFC) connectivity and multipathing with HPE Nimble Storage DSM and VSS support. However, Linux guest operating systems running in Hyper-V VFC configurations are not qualified.</p> <p>Running Red Hat Linux guest operating systems with the “Linux Integration Services” kit installed, or with hv_storvsc drivers in such configurations can lead to Red Hat bug 1364282, which can cause an unexpected service outage.</p>
Important	<p>Starting with NimbleOS 5.3.1.0, additional Unit Attention (UA) codes for iSCSI have been added to notify hosts to take appropriate actions for array side changes. <code>INQUIRY_DATA_HAS_CHANGED</code> has been added to allow the host(s) to account for management IP address changes. <code>CAPACITY_DATA_HAS_CHANGED</code> has been added to allow the host(s) to account for volume size changes.</p>

Note	Description
Important	<p>After performing an update to NimbleOS software version 5.3.x, the updated Nimble vCenter plugin may not be deployed to vCenter. As a result, the vSphere client will not list the Nimble array group correctly. Instead, a 404 NOT FOUND error is displayed, indicating that it could not download the proper resources to load the page. In addition, the Undeploy plugin task will continue to show as running in the Task Console for several hours.</p> <p>To resolve this issue:</p> <ol style="list-style-type: none"> 1 Unregister the vCenter plugin from the HPE Nimble Storage array using either the CLI or UI. 2 Log in to the vCenter as <code>\root</code> and run the following commands: <pre data-bbox="743 598 1458 898"> (service-control --stop vsphere-ui; rm -vfr /etc/vmware/vsphere-ui/vc-pack- ages/vsphere-client-serenity/com.nimblestor- age*; service-control --start vsphere-ui) & (service-control --stop vsphere-client; rm -vfr /etc/vmware/vsphere-client/vc-pack- ages/vsphere-client-serenity/com.nimblestor- age*; service-control --start vsphere-client) & </pre> <p>This will stop the vSphere UI service, cleanup any existing Nimble plugin packages, then restart the vSphere UI service.</p> 3 Re-register the vCenter plugin with the HPE Nimble Storage array using either the CLI or UI. 4 Log out and log in to the vSphere client to verify that the plugin is deployed. <p>This issue is tracked under software defect PRT-495.</p>
Important	<p>Starting with NimbleOS 5.1.1.0, the size of the software package now exceeds 2 GB, which may lead to lengthier software download times. Previously, the sizes of the NimbleOS 5.0.x download packages were approximately 1.6 GB, and NimbleOS 4.x packages were approximately 900 MB.</p>
Important	<p>After completing the NimbleOS update for array groups configured for Synchronous Replication, download the corresponding version of the Synchronous Replication Witness software, and update the witness host.</p>
Important	<p>Microsoft Offload Data Transfer (ODX) is not supported if the destination volume has synchronous replication enabled.</p>
Important	<p>As of vSphere 7.0, VMware has discontinued the flex client. Consequently, the HPE Nimble Storage vCenter Plugin no longer supports the flex plugin for vCenter 7.0.</p>

Note	Description
Important	<p>You can enable deduplication for CS1000, CS3000, CS5000, CS7000, CS700, and CS500 arrays on a volume only if the corresponding storage pool has a Flash to Disk Ratio (FDR) greater than 4%. To calculate the FDR, obtain the "Total array capacity (MiB)" and "Total array cache capacity (MiB)" values by using the HPE Nimble Storage CLI command pool pool_name. This command returns the Pool capacity (MiB), which is the "Total array capacity (MiB)", and the Pool cache capacity (MiB), which is the "Total array cache capacity (MiB)".</p> <p>Then perform the following calculation:</p> <p>FDR = "Total array cache capacity (MiB)"/"Total array capacity (MiB)" * 100</p> <p>If the array has sufficient capability for deduplication, the pool --info command will also show a value for dedupe capacity (MiB).</p> <p>Note On the HF20H, HF20, HF40, and HF60 platforms, pool --info displays "N/A" as the value for dedupe capacity (MiB). This is because you can enable deduplication for the entire array.</p>
Important	<p>For connections to the NimbleOS GUI, you must have port 5392 open for the Group Management IP address and both diagnostic IP addresses.</p>
Important	<p>Numerous host integration toolkits are supported in NimbleOS 5.3.1.100. It is strongly recommended that they be installed on all Windows, Linux, and VMware hosts. For more information about supported toolkits, refer to the Validated Configuration Matrix, which is available on HPE Nimble Storage InfoSight:</p> <p>https://infosight.hpe.com/resources/nimble/validated-configuration-matrix</p>
Important	<p>HPE Nimble Storage recommends that you update to HPE Nimble Storage Windows Toolkit (NWT) 7.0.1 or later if you are using Microsoft VSS Synchronization and NimbleOS 5.1.4.200 or later.</p> <p>Using application consistent snapshots with earlier versions of NWT and NimbleOS 5.1.4.100 may result in the following error messages:</p> <ul style="list-style-type: none"> In the host's VSS requestor log (C:\ProgramData\Nimble Storage\Logs\VssRequestor.log): <pre>PID:1996 TID:5752 ERR reqcommon. cpp:683 Request-Status=QueryStatus(), Function=pAsync->QueryStatus(), Error=VSS_E_PROVIDER_VETO, rc=SystemError, ca=ContactSupport</pre> In the Windows event viewer: <pre>event id 4100: EndPrepareSnapshots method: failed to find LUN s/n <SERIAL_NUMBER> on connected arrays. Make sure that the Nimble array version is compatible with this version of Nimble Windows Toolkit.</pre> <pre>event id 4170: Nimble VSS provider is not compatible with the current version of the Nimble array software(). Install appropriate version of the Nimble VSS provider.</pre> <p>NWT 7.0.1 resolves this issue.</p>

Note	Description
Important	<p>HPE Nimble Storage Connection Manager (NCM) for VMware 7.0 is signed by VMware for ESXi 7.x. It can be installed through the VMware Update Manager or esxcli command without the --no-sig-check flag.</p> <p>See the NCM for VMware Release Notes 7.0 or later and the latest <i>VMware Integration Guide</i> for further details.</p> <p>To locate the latest version of the guide, log in to HPE InfoSight. Choose Resources > Nimble Storage Documentation. In the left pane, click Integration Guide, then click Connection Manager (NCM) for VMware. From the list displayed, choose the version of the guide that you want.</p>
Important	<p>Various timeout values affect HPE Nimble Storage targets from Windows/Linux hosts. Before you update the NimbleOS, install the HPE Nimble Storage Windows Toolkit (NWT) or HPE Nimble Storage Linux Toolkit (NLT) on the host or tune the timeout values. Timeout details for various operating systems can be found on HPE InfoSight under Resources > Documentation. From the HPE Nimble Storage Documentation page, locate the article you want.</p> <p>The following Knowledge Base articles and Integration Guides explain how to configure and verify host timeout settings for the major supported operating systems (OS):</p> <ul style="list-style-type: none"> For Windows, refer to KB-000052: Windows Host Disk Timeout Values. In the context of Microsoft Windows, the following article should also be considered: KB-000246 MPIO Timeout Parameters for MSDSM and NimbleDSM in Windows 2012 R2 For VMware, refer to the Common Tasks and Best Practices > Host Timeout Values section of the <i>VMware Integration Guide</i>. For Linux, refer to KB-000304: Linux Host Disk Timeout Values.
Important	<p>vVol VMs cannot be claimed after they are deleted from the downstream array.</p> <p>A vVol VM can be protected and may subsequently be replicated to a downstream array (as configured in the storage policy). In the case where this vVol VM was deleted, a supported “claim” workflow allows us to claim this vVol VM on the downstream array.</p> <p>Due to validation failures in the vCenter, this workflow is not supported if it is performed in an environment where the vCenter version is 6.5 or later.</p> <p>See the following VMware DCPN Ticket Reference: https://dcpn.force.com/TechnicalRequestCaseRedesignPartner?Id=5000H00001JRKhf</p>

New Features in 5.3.1.100

There are no new features introduced with NimbleOS 5.3.1.100.

Recent Release Features

Recently released features in NimbleOS 5.3.x include:

25Gb NICs

Adds support for dual-ported Ethernet cards with 25Gb speeds.

Synchronous Replication Performance Improvements

Provides performance improvements during re-synchronization of synchronously replicated volumes.

Single-click Upgrades of dHCI Service Pack for ProLiant Gen 10

Provides a single-click upgrade process for ProLiant Gen 10 Service Packs in dHCI environments.

dHCI: Allow User to Assign iLO to Separate Network/VLAN (Split Management)

Allows ProLiant iLOs to be configured on separate management networks during dHCI setup.

Report Windows Host Information to the Array

Allows HPE Nimble Host Utilities to post support information to the array .

External KMIP Integration

NimbleOS now supports using an external key manager to manage the master encryption key. External key management is done via the industry standard KMIP protocol, and any KMIP supporting key manager may be used.

Documentation

These Release Notes and other user documentation are available on HPE InfoSight:

<https://infosight.hpe.com/resources/nimble/docs>

You can manually reach the documentation page by logging onto HPE InfoSight and selecting **Resources > Nimble Storage > Documentation**.

Document Search Interface

There are several methods you can use to locate the documents you need.

The **Nimble Storage Documentation** page provides a search interface that allows you to search for information across all documentation, including support and knowledge base articles, best practices, solutions and integration guides, product documentation, and configuration matrices.

To go directly to a document, use the navigation pane on the left side of the **Nimble Storage Documentation** page. The navigation pane organizes documents into categories, including:

- Document Type
- Nimble Software and Solutions
- Software Version
- Integration
- Platform

You can use the page scroll bar to move up and down the navigation pane.

Third-Party Software Notices

All third-part software notices can be found in the Documentation Portal on HPE InfoSight.

Here are the steps to manually access the third-party software notices.

- 1 Log in to HPE InfoSight (<https://infosight.hpe.com>).
- 2 From the menu, select Resources Nimble Documentation .
- 3 In the left navigation pane of the Documentation Portal, scroll through the Document Type section and select Support Policy.
- 4 From the list of documents, select General Terms and Conditions. The document opens in a new browser tab.

Core User Documentation

The following is the core user documentation for NimbleOS:

- *GUI Administration Guide*
- *CLI Administration Guide*
- *SNMP Reference*
- *Command Reference*
- *REST API Reference*

If you are using an HPE Nimble Storage dHCI-enabled array, you should also check the dHCI Deployment Guides and Getting Started Guide.

Workflow Documents

There are several workflow guides that contain procedures you can perform using either the CLI or the GUI. Each workflow guide covers a specific, frequently performed task related to HPE Nimble Storage products. Each task described by a workflow document is explained in detail in the *GUI Administration Guide* and the *CLI Administration Guide*.

Hardware

Documentation for all hardware components is available on HPE InfoSight. Click the Hardware Guide link in the **Document Type** category. Hardware documentation includes array and expansion shelf installation quick start guides, installation, upgrade, and replacement guides, and comprehensive hardware guides.

Host Integration Guides

Host Integration Guides are available from HPE InfoSight. To locate these documents on the HPE InfoSight **Documentation** page, scroll down the navigation pane to the section called **Integration Guide**.

Note A single Host Integration Guide supports multiple version of NimbleOS and the companion Integration Toolkit software packages. The version number listed on the guide might be different from the version numbers of the NimbleOS and Toolkit software packages that it supports.

Verified Update Paths

Table 1: From Versions 5.x

From Versions 5.x	
From Version	To Version
5.3.1.0	5.3.1.100
5.3.0.0	5.3.1.100
5.2.1.400	5.3.1.100
5.2.1.300	5.3.1.100
5.2.1.200	5.3.1.100
5.2.1.100	5.3.1.100
5.2.1.0	5.3.1.100
5.1.4.200	5.3.1.100
5.1.4.100	5.3.1.100
5.1.4.0	5.3.1.100
5.1.3.100	5.3.1.100
5.1.3.0	5.3.1.100
5.1.2.100	5.3.1.100
5.1.2.0	5.3.1.100
5.1.1.0	5.3.1.100
5.0.10.0	5.3.1.100
5.0.9.100	5.3.1.100
5.0.9.0	5.3.1.100
5.0.8.100	5.3.1.100
5.0.8.0	5.3.1.100
5.0.7.300	5.3.1.100

From Versions 5.x	
From Version	To Version
5.0.7.200	5.3.1.100
5.0.7.100	5.3.1.100
5.0.7.0	5.3.1.100
5.0.6.0	5.3.1.100
5.0.5.200	5.0.10.0
5.0.5.0	5.0.10.0
5.0.4.0	5.0.10.0
5.0.3.100	5.0.10.0
5.0.3.0	5.0.10.0
5.0.2.0	5.0.10.0
5.0.1.100	5.0.10.0
5.0.1.0	5.0.10.0

Table 2: From Versions 4.x

From Versions 4.x	
From Version	To Version
4.5.6.0	5.0.10.0
4.5.5.0	5.0.10.0
4.5.4.0	5.0.10.0
4.5.3.0	5.0.10.0
4.5.2.0	5.0.10.0
4.5.1.0	5.0.10.0
4.5.0.0	5.0.10.0
4.4.1.0	5.0.10.0
4.4.0.0	5.0.10.0
4.3.1.0	5.0.10.0
4.3.0.0	5.0.10.0
4.2.1.0	5.0.10.0
4.2.0.0	5.0.10.0
4.1.0.0	5.0.10.0

Table 3: From Versions 3.x

From 3.x Versions	
From Version	To Version
3.9.3.0	5.0.10.0
3.9.2.0	5.0.10.0
3.9.1.0	5.0.10.0
3.9.0.0	5.0.10.0
3.8.1.0	5.0.10.0
3.8.0.0	5.0.10.0
3.7.0.0	5.0.10.0
3.6.2.0	5.0.10.0
3.6.1.0	5.0.10.0
3.6.0.0	5.0.10.0
3.5.4.0	5.0.10.0
3.5.3.0	5.0.10.0
3.5.2.0	5.0.10.0
3.5.0.0	5.0.10.0
3.4.1.0	5.0.10.0
3.4.0.0	5.0.10.0
3.3.0.0	5.0.10.0
3.2.1.0	5.0.10.0
3.1.0.0	5.0.10.0

Table 4: From Versions 2.x

From 2.2.x, 2.3.x Versions		From 2.1.x Versions		From 2.0.x Versions	
From Version	To Version	From Version	To Version	From Version	To Version
2.3.18.0	4.5.6.0	2.1.9.1	2.3.18.0	2.0.8.0	2.1.9.1
2.3.16.0	4.5.6.0	2.1.9.0	2.3.18.0	2.0.7.0	2.1.9.1
2.3.15.0	4.5.6.0	2.1.8.0	2.3.18.0	2.0.6.*	2.1.9.1
2.3.14.0	4.5.6.0	2.1.7.0	2.2.9.0	2.0.5.0	2.1.9.1
2.3.12.*	4.5.6.0	2.1.6.0	2.2.9.0	2.0.4.0	2.1.9.1
2.3.9.*	4.5.6.0	2.1.5.0	2.2.9.0		
2.3.8.0	4.5.6.0	2.1.4.0	2.2.9.0		
2.3.7.0	4.5.6.0	2.1.3.0	2.2.9.0		
2.3.6.0	4.5.6.0	2.1.2.0	2.2.9.0		

From 2.2.x, 2.3.x Versions		From 2.1.x Versions		From 2.0.x Versions	
From Version	To Version	From Version	To Version	From Version	To Version
2.3.4.0	4.5.6.0	2.1.1.0	2.1.9.1		
2.3.3.0	4.5.6.0	2.1.0.0	2.1.9.1		
2.3.2.1	4.5.6.0				
2.3.2.0	4.5.6.0				
2.3.1.0	4.5.6.0				
2.2.11.0	3.9.3.0				
2.2.10.0	3.9.3.0				
2.2.9.0	3.9.3.0				
2.2.7.*	3.9.3.0				
2.2.6.0	3.9.3.0				
2.2.5.*	3.9.3.0				
2.2.3.*	2.2.11.0				
2.2.2.0	2.2.11.0				
2.2.1.0	2.2.11.0				
2.2.0.0	2.2.11.0				

Table 5: From Versions 1.x

From 1.4.x Versions		From 1.3, 1.2, 1.1 Versions		From 1.0.x Versions	
From Version	To Version	From Version	To Version	From Version	To Version
1.4.12.0	2.1.9.1	1.3.**	1.4.6.0	1.0.7.*	Contact Support
1.4.11.0	2.1.9.1	1.2.**	1.4.6.0	1.0.6.*	Contact Support
1.4.10.0	2.1.9.1	1.1.**	1.2.2.0		
1.4.9.0	2.1.9.1				
1.4.8.0	2.1.9.1				
1.4.7.0	2.1.9.1				
1.4.**	1.4.12.0				

Known Critical Issues

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-115397	Data Service	Data Service disabled on array due to NVRAM Checksum mismatch	On Data Service startup followed by a failover, during the recovery process, it is possible to hit a checksum mismatch. The Data Service restarts when the mismatch is encountered. The service will make three attempts to restart, before disabling the service.	Contact HPE Nimble Storage Support.
AS-116051	Data Service	Data Service may restart unexpectedly	In rare instances, the Data Service may restart unexpectedly while performing Volume Management checksum computations.	Contact HPE Nimble Storage Support
AS-77607	Data Service	Removing member array from multi-array group may cause IO disruption to scaled vVol environments	Scaled vVol environments with 500 vVol VDI VMs or more than 5000 Nimble vVol volumes may experience IO disruption when removing a member array from group. Symptom of problem would appear as vVol datastores being (inaccessible). Virtual Machine status would also appear as (inaccessible).	When planning to remove a member array from group, schedule a planned maintenance window and place all ESX hosts into maintenance mode to minimize impact to availability. ESX typically resumes connection to vVol datastores, and reconnects to VMs, after a period of 15-30 minutes automatically without a manual intervention.
AS-101976	Data Service	Volume move may result in latency if Nimble Connection Manager is not installed	Volume moves transfer data from one Nimble array to another. During this move, if the host sends I/O to the incorrect array, the I/O needs to be forwarded to the correct array owning the data. This results in higher than usual I/O latency. To avoid this issue in VMware environments, the Nimble Connection Manager for VMware needs to be installed on all hosts accessing the volume.	Not applicable
AS-114277	Data Service	Data service may restart unexpectedly	The Data service may restart unexpectedly when a checksum verification failure occurs.	Not applicable
AS-90668	Data Service	Data Service restarts when detecting metadata inconsistency	When the Data Service detects a metadata inconsistency, the service may restart repeatedly and hosts could experience unexpected application behavior.	Contact HPE Nimble Storage Support

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-106093	Data Service	Data service may restart due to a race condition	While committing internal transactions, Data Service may hit a rare race condition. To recover from this Data Service might restart	Not applicable
AS-105607	Data Service	Snapshot replication of deduplication-enabled volumes may lead to File System restart	During snapshot replication of a dedupe-enabled volume, the downstream array file system may restart due to an out-of-memory condition.	Not applicable
AS-94834	Data Service	Data Service may unexpectedly restart	A disruption in network connections can cause Data Service to restart unexpectedly.	Not applicable
AS-108094	Data Service	Replication interruptions and Data Service restarts may occur due to network errors	In environments with frequent network checksum errors, interruptions of Replication and Data Service restarts may occur.	Review network devices to identify and reduce network checksum errors.
AS-109826	Data Service	Data Service may restart unexpectedly	Data Services may unexpectedly restart due to out of memory condition while running snap replication on dedupe enabled volumes with high compression ratios.	Not applicable
AS-95470	Data Service	Pool merge fails due to too many pending deletes	When attempting to perform a pool merge operation, if there are a large number of volumes that must be striped across the pool, and one of the arrays has a large number of pending deletes, then it is possible for the operation to fail due to the Data Service being overloaded. Symptoms of this behavior are if the pool merge operation hangs for several minutes and returns the following message: The request could not be understood by the server.	Not applicable
AS-76236	Data Service	Data Service may restart unexpectedly during volume migration	Data Service may restart when operations of volume migration are stuck waiting for ownership transfer completion.	Not applicable

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-86764	Platform	Controller sensors missing for AFxx/HFxx arrays	During boot up due to a known Intel defect the controller sensors may report missing for a period of time in the array alerts. After about 15-20 minutes, it returns to a valid state and the sensors should report valid readings again.	If after 20 minutes the controller sensors do not report good state, please contact HPE Nimble Storage Support for assistance.
AS-86099	Platform	Data service may restart during when file operation timeout is exceeded	During internal file operations, processes may be waiting for a lock to be released. If the wait time exceeds 30 seconds, a service health check may restart the Data service to recover.	Not applicable
AS-104517	Platform	Data Service may restart due to health check failure	The Data Service on the array may restart when timeout for internal communication between array controllers has been exceeded. The service restarts to restore the communication.	Not applicable
AS-108793	Platform	Data Service may restart if the array has multiple bad drives	In rare instances, the Data Service may restart if the array has multiple bad drives which make IO handling very slow.	Contact HPE Nimble Storage Support to review disks for replacement.
AS-96053	Platform	NDER process may lead to host reconnects	Nimble Drive Error Recovery (NDER) is activated for drives failing I/O in an attempt to recover the drive. In rare instances, the process may surpass iSCSI host timeout values, causing host I/O inaccessibility.	Not applicable
AS-107489	Platform	Limited thermal monitoring policy for PCIe components	The current thermal policy has a limitation where individual PCIe components are not monitored on card-by-card basis. As a result, the high level temperature policy that is current implemented, is sometimes incapable of regulating the temperatures of individual cards.	Not applicable
AS-51053	Platform	Array remains in solo/stale after controller reseal.	In rare instances the interconnect between controllers may be down following a controller reseal.	Contact HPE Nimble Support for assistance in restoring array to Active/Standby status.

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-93456	Platform	Incorrect software update error message /tmp is out of space.	During software update from NimbleOS 3.x versions to later version, a failure to extract the software update package may incorrectly return the error message /tmp is out of space. even if there is still space in the directory.	Verify that the software update package has been downloaded to the system and then attempt the software update again using the software --resume_update command from the CLI.
AS-112859	SAN	Data service may restart unexpectedly	The Data Service on the array may restart if a Task Management Function request to abort a command is received while the command is still being completed. The service restarts to recover from the condition.	Not applicable
AS-115780	Security	Event service may restart unexpectedly	The Event service may restart unexpectedly when attempting to load a trusted certificate due to an issue which impacts certificate management. The service may not restart after encountering the issue.	Contact HPE Nimble Storage Support
AS-110030	System Management	Group Management service may restart due to race condition	Group Management service may restart due to a race condition between threads when a volume access control list is removed. The service restarts to recover from the condition.	Not applicable
AS-94737	System Management	No Automatic Failover in the event the host loses all FC connectivity to an array	An Automatic Failover (AFO) of the Group Management Services will not be initiated if all Fibre Channel (FC) interfaces on the Group Leader array fail on both controllers.	A Manual Group Leader Failover will be required to restore Fibre Channel connectivity to the hosts.
AS-65615	System Management	Group Management Service must be restarted to unlock additional volume limits after controller upgrade	When performing a controller upgrade to a high-end model, the object limits will still show the lower limits if the Group Management Service is not restarted.	A failover can be initiated in order to restart the Group Management Service. You may also contact HPE Nimble Storage Support to restart the service manually.

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-110947	System Management	Backup Group Leader may experience network connectivity issues in Peer Persistence group	When the array group is configured for Peer Persistence and the management subnet is configured with VLAN tagging, the character limit for the interface created for the Secondary Management IP will be exceeded. This can cause this Secondary Management IP to be unreachable.	Remove the VLAN tagging from the management network to prevent network connectivity issues in Peer Persistence Group.
AS-61614	System Management	Group Management service may restart during array shutdown	The Group Management service may restart during an array shutdown while processing REST request. No user operations are impacted because the array is already in the middle of a shutdown. The shutdown proceeds normally.	Not applicable
AS-69136	System Management	Group merge fails if one of the groups violates the snapshot rate limit	The Snapshot rate limit - Number of snapshots that can be taken for a given minute - is introduced in 4.x for distributing snapshot load to the system. If a group surpasses this snapshot rate limit in previous NimbleOS releases, the software update to 4.x is still allowed. However, a group merge is prevented if the source or destination array surpasses the snapshot rate limit. The following error message can be seen during the group merge validation: INFO: Rate of snapshots in the merged group would be greater than supported snapshot rate. This could occur if even if the source array (the array being added to the existing group) has 0 volumes or volume collections.	Contact HPE Nimble Storage Support.
AS-94113	System Management	Group Management service may restart due to duplicate snapshot collection name	If an attempt is made to create a snapshot collection with same the name of an existing snapshot collection, an error indicating object already exists will be reported and the Group Management service may restart. The service will recover upon restart.	Use unique name when creating snapshot collection.

Known Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-100254	System Management	Group Management Service restarts under heavy load	A system management process can restart when the system is under heavy load. The system recovers automatically. The Data service is not affected.	Not applicable
AS-98124	System Management	Array Management service restart during service shutdown	The Array Management service may restart due to a race condition encountered during service shutdown. The service will recover after the restart.	Not applicable
AS-87736	System Management	Software precheck failures return generic error message	If a software update precheck fails, in some cases it will return only the failure status without providing additional information about the cause of the failure.	Contact HPE Nimble Storage Support for assistance in determining the cause of the failure.
AS-98194	System Management	Group Management Services unavailable temporarily when performing volume restore	Group Management may become unavailable temporarily when a large number of restores are performed on a volume.	Not applicable
AS-95169	System Management	Graceful shutdown takes longer than expected	In rare occurrences, a customer-initiated reboot may cause a kernel reboot on the active controller. This will cause a longer reboot cycle.	Not applicable
AS-84499	System Management	Controller may unexpectedly restart due to high memory utilization	Controller may reboot unexpectedly if there is high memory utilization for the java and/or jetty processes on the array.	Not applicable
AS-97968	System Management	Page footer in GUI may fail to update after bulk update operation	After performing a bulk update operation from the Manage > Data Storage > Volumes > volumename > Data Protection tab in the GUI, the page footer may not update and previous button may be unavailable.	Refresh the page to restore button functionality.
AS-92379	System Management	Unable to Filter volumes using Synchronous Replication	There is currently no way to filter volumes using Synchronous Replication within the array GUI.	Use volume collections to check syncRep volumes, or use other filters to meet the needs

Resolved Critical Issues

Resolved Critical Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-117318	Data Service	NimbleOS 5.3.1.0 may not be able to properly detect certain NVRAM failure scenarios	In rare circumstances, an issue with NVRAM could go undetected and result in an instance of extended data unavailability.	Perform a software update to NimbleOS version 5.3.1.100 or later to address this issue.

Resolved Issues

There are no resolved issues in NimbleOS version 5.3.1.100

Known Issues

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-115328	Data Service	Data Service restarts unexpectedly while allocating data pages	When trying to allocate data pages for many large Fingerprint Index Hash Table indirect blocks, the process may fail due to insufficient memory. As a result, the Data Service may restart to recover the condition.	Contact HPE Nimble Storage Support
AS-109218	Data Service	Data service may restart unexpectedly	The Data Service may restart unexpectedly during a read operation when decryption and decompression fails.	Not applicable
AS-102001	Data Service	Data Service may restart unexpectedly due to internal database communication	In rare instances, the Data Service may restart when internal database communication between services is not available. The service restarts to restore the communication between services.	Not applicable
AS-74773	Data Service	Data Service may restart during branch point deletion	A volume that has a chain of at least three branches, common in replication or snapshot restore workflows, may trigger unexpected Data Service restarts upon branches being trimmed and deleted.	Not applicable
AS-111378	Data Service	Data Service may restart due to health check failure	A lost wake-up to an operation may cause the operation blocking the checkpoint which results in Data Service restart.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-81863	Data Service	Data Service may restart unexpectedly when RAID is in degraded mode	When RAID is degraded, IO needs to be reconstructed by reading from multiple disks, and an internal buffer may exhaust its allocated resources. In rare cases when multiple disks are degraded, the Data Service may restart unexpectedly.	If RAID is degraded for an extended period and Data Service restarts occur, contact HPE Nimble Storage to assess adjusting allocated buffer resources.
AS-62942	Data Service	Data Service may restart unexpectedly for CS2XX and CS3XX arrays when under a heavy load	On CS2XX or CS3XX, the array may run out of data pages when under a heavy load. This will result in an unexpected Data Service restart.	Reducing the load on the array is the only known workaround for this issue.
AS-77117	Data Service	File system service may restart on upstream array during replication or resync of synchronous replication.	In rare instances during offset calculation, the File System service may restart when attempting to read data for replication. The service restarts to recover from the condition.	Not applicable
AS-115912	Data Service	Data service may restart unexpectedly	Software update to NimbleOS 5.2.1.0 and later triggers an update of on-disk data structures. Under certain rare conditions, this update could potentially take a long time and result in a restart of the Data Service. This may cause a momentary delay in IO but should not result in any significant disruption, as the data services daemon is designed to restart efficiently before any IO timeout can occur.	Not applicable
AS-102881	Data Service	Data Service Restart due to a race condition during metadata sync	During NimbleOS metadata sync, in rare instances, the data service may restart unexpectedly. The metadata sync operation itself wont be affected and the restart will reset the race condition; the data service will stabilize after the restart.	Data service will be available after restart.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-87108	Data Service	Data Service may restart unexpectedly with VM health check failure due to lock contention.	Under certain conditions, the Data Service may restart when a large number of internal indexes merge within a short time-span and when some of these indexes need to merge multiple times in the same checkpoint. In this case, there can be lock contention between operations responsible for picking what to merge and operations processing the merge, leading to health check timeout.	Not applicable
AS-61877	Data Service	Deadlock in Data Service process may cause a restart	Under rare circumstances, internal threads in the Data Service can enter a deadlock when contending on the same set of resources. When the process health monitor detects this deadlock, it will force the Data Service process to restart in order to recover from this situation.	Not applicable
AS-70861	Data Service	Data Service may restart due to volume manager health check failure	The Data Service may restart unexpectedly if the Volume Manager health check exceeds expected time out. The service restarts to clear the condition.	Contact HPE Nimble Storage Support
AS-85848	Data Service	Data Service may restart unexpectedly with health check failure when internal index data structures take too long to merge	As part of the file system checkpoint process, internal indexes are required to merge to disk. The health check process uses a heartbeat mechanism to determine if the merge is making progress. Under some circumstances, the process performing the merge of a batch of updates to the index fails to heartbeat within a deadline. When that happens, the Data Service may restart with a health check failure.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-115204	Data Service	Data service may restart unexpectedly	The data services daemon periodically synchronizes its persistent in-memory (NVRAM) structures with its other objects on flash. This process is required to complete within a reasonable amount of time. Under certain rare conditions, this process can get delayed and trigger a restart of the data services daemon. This can cause a momentary delay in IO which the daemon restarts. There should not be any disruption of IO, since the daemon is designed to restart within any IO timeout limits.	Not applicable
AS-112307	Data Service	File System Service may restart due to memory exhaustion	The File System Service may unexpectedly restart because it is not able to allocate memory. This can happen when the process in charge of evicting data out of cache cannot evict fast enough, so the filesystem is unable to allocate memory for new incoming data.	Not applicable
AS-109266	Data Service	Data Service may restart during metadata invalidation	The Data Service may restart unexpectedly on an array group with Storage Class Memory and Synchronous Replication configured, during an automatic failover (AFO) event. This occurs when invalidating index data in memory exceeds the timeout of 30 seconds.	The array group will recover itself following the Data Service restart.
AS-71309	Data Service	Unexpected Data Service Restart	Under certain circumstances, an unexpected Data Service restart may be triggered with a generic Asynchronous Task Manager health check failure. The Data Service restarts and resumes operation normally, without causing loss of access from the connected hosts.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-111353	Data Service	Multi-array setup with replication might experience file system restarts when peer array is unreachable	In certain multi-array setup where replication is in progress might encounter a situation where peer array is going through a software upgrade and is actually unreachable by other array. The other array is however unaware of it because some network device has intervened the reachability status of the peer array. The other array needs to perform certain operations which has a timeout associated with it and undergoes a system restart to recover.	Not applicable
AS-111235	Data Service	Data Service restarts when one of the processes incorrectly sets its return status.	In one of the code paths for the process that handles fingerprint mapping, the merge status is not properly set. This may lead to an unexpected Data Service restart.	Not applicable
AS-84426	Data Service	Group Data Service may restart unexpectedly	The Group Data service may restart unexpectedly when out of memory condition is encountered. The service restarts to clear the condition.	Not applicable
AS-116064	Data Service	Data Service may restart due to health check failure	While the Data service is processing Update Entries in background, one of these background operations may exceed the expected timeout and the service will restart to recover.	Not applicable
AS-96703	Data Service	Data Service may restart due to volume manager health check failure during generation deletion	Generation delete loads a large number of ondisk metadata blocks which may prevent block index operation checkpoint from finishing. This causes the volume manager health check to fail which results in Data Service restart.	Not Applicable, the Data Service will resume normal operation after restart.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-96779	Data Service	Data Service may restart unexpectedly due to race condition	When a read op finds partial data in-core, it issues a media read to get remaining data. By the time, media read returns, the in-core data is synced, and tree is reopened for deletion. The read does not expect tree to be in delete state and causes the Data Service to restart.	Not applicable
AS-94473	Data Service	Data Service may restart when running out of buffers	When flash cache Garbage Collection copies forward live data of a fragmented segment, it could consume more buffers than provisioned and cause the Data Service to restart to recover.	Contact Nimble Storage Support.
AS-108519	Data Service	File system restart to recover from stalled replication	Due to issues in communicating with the partner array during replication, there are few cases where the operation is not able to make progress. As a result, the file system may restart to correct this condition.	Not applicable.
AS-111347	Data Service	Data service may restart due to a race condition	While committing internal transactions, Data Service may hit a rare race condition. To recover from this Data Service may restart.	Not applicable
AS-81739	Data Service	Data Service restart due to slow disk IO or disk IO failure	If IO to disk are slow or fail, the Data Service may restart to try to recover the condition.	Not applicable
AS-106924	Data Service	Data Service may restart due to network errors	In rare cases, Data Service may restart during snapshot replication due to the failure of checksum algorithms to detect all network errors.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-50446	Data Service	Data Service may restart during internal task scheduling	During replication, a rare race condition between adding and deleting internal recurring tasks can cause a Data Service restart. Arrays that hit this condition typically experience a single service restart that automatically recovers the condition. However, if the network link used by replication is unstable, frequent replication disconnects dramatically increase the likelihood of encountering multiple Data Service restarts due to this condition.	Pause replication until the network link used for replication is stabilized.
AS-92170	Data Service	Data Service can restart unexpectedly during shutdown process	Due to a race condition, the Data Service may restart during a graceful shutdown causing unexpected Data Services restart messages to be generated. This should not cause any I/O impact because the Data Service is already in the process of shutting down.	Not applicable
AS-97038	Data Service	Disabling encryption may cause Synchronous Replicated volumes to remain out of sync	Disabling encryption might cause NVRAM data to fill up with data waiting for master passphrase, which can cause Synchronous Replicated volumes to go out of sync.	Enabling encryption will resolve the issue
AS-113537	Data Service	Data Service may restart unexpectedly	The Data Service may restart unexpectedly if Fibre Channel session termination exceeds timeout to complete. The service restarts to recover from the condition.	Not applicable
AS-105551	Data Service	Arrays may experience increased latency during copy offload workload operations	Copy offload optimizations for deduplication were added in NimbleOS versions 5.1.x and later. The changes may lead to increased latency when copy offload workflows are added to the array. This is due to an increase in update entries requiring processing.	Perform one of the following options to avoid/mitigate the issue: 1. Reduce overall workload on the array. 2. Reduce copy offload workload on the array. Contact HPE Nimble Storage Support if further assistance is needed.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-86720	Data Service	Unassigning and reassigning array to a pool within 5 minutes will fail	Assigning an array to a pool immediately after unassigning it from the same pool will fail with the following error - Failed to assign arrays to the pool: A service is not running or is not reachable	Retry operation after a few minutes to reassign array to pool.
AS-94545	Data Service	Very rare race between Vol claim (with all snapshots marked for deletion) and space recalculation on replica downstream volume	The service may restart when removing the downstream replica using the steps below. 1. Deletion of all snapshots for the replica volume. 2. Claim the replica volume 3. Delete the replica volume	Remove downstream replica using the correct steps ordered below. 1. Claim the replica volume. 2. Delete all of the snapshots for the replica volume. 3. Delete the replica volume.
AS-79265	Data Service	Data Service may restart on downstream array due to race condition during volume deletion	The volume manager will decrement bin and child volume folder entries during volume deletion. In rare occurrences, another thread may decrement the child volume entry and not the bin entry, causing the Data service to restart.	Not applicable
AS-111454	Data Service	Aggressive Volume creation and deletion may result in Data Service restart	Aggressive volume creation and deletion may cause one of the tree data structures to hit maximum children it can have. This limit can occur on volume creation because volume deletion destroys the children asynchronously. The Data Service will restart when this limit has been reached.	Reduce the frequency of volume clone create and delete operations to minimize the likelihood of occurrence.
AS-57016	Data Service	Aggressive assert may lead to unexpected restart of the Data Service	Under certain circumstances, an aggressive internal assert may lead to unexpected restart of the Data Service.	Not applicable
AS-113545	Host Integration	Group Management service may restart when attempting to create VSS snapshot	The Group Management service communicates with the VSS service when creating VSS snapshots. If this communication is not able to be completed within the expected timeframe, the service restarts to recover.	Not applicable
AS-108647	Host Integration	Cimserver stops when memory limit is exceeded.	In some instances the cimserver service will exceed its memory limit and no longer be able to start.	Contact HPE Nimble Storage Support to increase the memory limit for the service.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-50033	Platform	Log partition may fill up	Log files generated by processes in the Nimble Operating systems are rotated and archived using certain parameters. Under some conditions, if processes log more than normal, this can result in the log partitions being filled up, leading to other issues with critical processes.	Contact Nimble Storage Support to identify the reason for the partition filling up and to clean up the log partition.
AS-100088	Platform	Controller does not power on following a power cycle.	In rare incidents, controllers do not power on following power cycle.	Please contact HPE Nimble Storage Support
AS-33725	Platform	Unexpected controller takeover due to incorrect state of the SAS HBA	When the SAS HBA detects faulty states, to recover, the array needs to reset the SAS HBA's firmware. The SAS HBA firmware reset can block disk I/Os significantly longer than our High Availability monitoring timeouts allow. Instead, a controller reboot is triggered immediately if this state is detected, resulting in an unexpected takeover event.	The controller reboot should restore SAS HBA to normal state. HPE Nimble Support may contact customer to collect additional diagnostics if required.
AS-67242	Platform	Incorrect shelf cabling can cause a series of unexpected Data Service restarts	If a shelf is cabled incorrectly and added to an array, the raw capacity calculation could fail leading to multiple restarts of the Data Service.	Referencing the corresponding Expansion Shelf Quick Start Guide, correct the hardware cabling issue.
AS-53621	Platform	Both power supplies showing up as missing	Under certain circumstances, internal commands may cause the integrated circuit to hang which causes both power supplies of the head shelf to appear as missing. The problem does not impact the power supplies ability to deliver power to the array.	<ol style="list-style-type: none">1. Reseat one of the power supplies to clear the hang condition.2. Or update NimbleOS to version 3.6.0.0 or later to minimize the number of internal commands that can trigger this issue.
AS-114564	Platform	File System service may be restart on truncated variable read	In certain conditions, I/Os tracked for certain operations may total zero, which triggers a check exception. The reason for the incorrect value is variable truncation. The service restarts to recover from the condition.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-95294	Platform	Enclosure Management service may unexpectedly restart due to drive status race condition	The Enclosure Management service may unexpectedly restart due to a race condition which is resulting from drive status which has already been marked removed by the Data Service. The restart of the service clears the condition.	Not applicable
AS-90850	Platform	Data Service may unexpectedly restart	The Data Service may restart unexpectedly when it detects an internal check error. The restart of the service clears the condition.	Not applicable
AS-110036	Platform	Data Service may restart if the array has an faulty drive with a high number of medium read errors	Data Service may become latent and restart when the array has a faulty drive with a lot of medium read and IO timeout errors.	Contact HPE Nimble Storage Support to identify the faulty drive for replacement.
AS-99567	Platform	Data Service may restart if a controller is low on memory	Data Service may restart in the rare case when a controller is low on memory.	The restart of the service will clear the low memory condition, no further action is needed.
AS-90096	Platform	Data Service restarts due to slow IO to one of the disks	In rare instances due to slow IO to one of the disks, the Data Service may hit a timeout and restart unexpectedly. This issue may occur during a NimbleOS software update.	Please contact HPE Nimble Storage Support so the problematic drive can be replaced.
AS-103802	Platform	Data Service restart due to resource allocation failure.	The Data Service may restart due to a transient resource allocation failure. This happens when the service cannot complete a disk IO due to transient memory allocation failure. This does not cause a service outage as Data service continues normally after a restart.	Not applicable
AS-46629	Platform	Kernel panics while processing host bus adapter errors	On very rare occasions of HBA error handling, interrupts could be turned off long enough for the NVRAM driver to timeout while trying to complete direct memory access operations. The controller recovers after a re-boot is initiated by the kernel.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-105053	Platform	Enclosure Management Service may restart unexpectedly	The Enclosure Management service may unexpectedly restart when it detects an internal check error. The service restart clears the condition.	Not applicable
AS-99428	Platform	Replacement disk reports foreign for disk state in GUI/CLI	Disk will report foreign for disk state in the GUI Hardware page or in the output of disk --list from the CLI. This typically occurs if diagnostic data may not have been removed after testing.	Add the disk from the CLI using the disk add command and output from disk list: 1. Run disk --list 2. Note the slot number, and shelf location for the disk labeled foreign. 3. Add the disk: disk --add <slot number>; --array <arrayname>; --shelf_location <shelf location>; Note: the --force option may be required Contact HPE Nimble Storage Support if the disk does not move to resynchronizing state after completing the commands.
AS-93296	Platform	Data service may restart if maximum cache exceeded for CS215, CS235, CS300, CS500, CS700 arrays	ES2 and AFS2 expansion shelves contain additional slots for upgrading cache capacity of the array. Older array models have a maximum cache limit that can be handled by the array. If ES2 or AFS2 expansion shelves are added to an array and the cache exceeds the max cache limit for the array type, the data service may restart due to running out of data pages.	Review the array configuration matrix for the array model: https://infosight.hpe.com/InfoSight/media/local/active/34/CSxxx%20Config%20Matrix.pdf Remove any additional cache from the expansion shelf that exceeds the max cache limit based on array model.
AS-91522	Platform	SSD has reached its endurance limit (wear leveling) but the disk is not marked failed.	In rare cases, an SSD may reach its endurance limit but continues to pass Nimble Drive Error Recovery algorithm. This causes a never-ending process of off-lining and on-lining the drive. This may occur for Intel and Toshiba SSDs.	Not applicable
AS-101570	Platform	Delay with Data Service starting during shelf state change	On rare occasions, the array groups Data Service may fail to initialize if a shelf state change occurs simultaneously.	No workaround is required. The array will recover itself automatically by restarting the Data Service.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-86100	Platform	Enclosure Management service occasionally restarts upon a drive failure	In a rare scenario, Enclosure Management service may occasionally restart upon a drive failure in system partitions. The restart of the service clears the condition.	Not applicable
AS-112701	Platform	Group Management service may restart unexpectedly	The Group Management service may restart if an error while opening interconnect-ips file occurs. The service restarts to recover from the condition.	Not applicable
AS-98885	Platform	Unexpected Group Management Service restart due to receive buffer exhaustion	The Group Management Service may restart unexpectedly due to receive buffer exhaustion on the management network interface. No visible impact has been reported because of this issue.	Not applicable
AS-92471	Platform	File System Service may restart unexpectedly	File System service may restart unexpectedly when a health check exceeds timeout for volume manager on the array. The service restarts to recover from the condition.	Not applicable
AS-76174	Platform	VM creation fails in VMWare VVol environment after update to NimbleOS 4.x.x.x	An attempt to create new VMs in a VMWare vVol environment fails after updating to NimbleOS 4.x.x.x. This occurs when a system partition within the array is running out of space.	Please contact HPE Nimble Storage Support to resolve this issue. This issue is resolved in NimbleOS version 5.0.2.0 and later.
AS-97685	dHCI	Nimble Add ProStack server task may hang if array failover occurs	If an array failover occurs while Nimble Add ProStack server task is running from vCenter, the process may hang and not complete.	After confirming the array has returned to Active/Standby status, stop the hung task and run the Nimble Add ProStack server task again.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-103315	dHCI	dHCI update workflow can fail if /var mountpoint on the host is full.	As part of the dHCI update workflow which involves the ESXi server update, some commands need to be run on the server. Running these commands fails with error Error: A general system error occurred: Internal error. if the /var is full. This is a known issue with 6.7 builds running with Emulex driver which has been fixed as part of ESX 6.7 U2. https://docs.vmware.com/en/VMware-vSphere/6.7/rn/vsphere-esxi-67u2-release-notes.html#resolvedissues	Free up /var disk space by deleting unwanted log files (/var/log/EMU/mili/mili2d.log) and rebooting the host.
AS-103247	dHCI	An in-progress dHCI update fails if the group leader fails over	When the dHCI unified update feature is used to update the dHCI stack, the update will fail if a Group Leader Failover occurs during the process.	The only way to resume the update would be to failover to the original group leader array and then resuming the update through the dHCI vCenter plugin.
AS-103769	dHCI	The update page on the dHCI plugin takes 4 hours to refresh	When an ESXi server is added to dHCI cluster, the update page does not get updated to include the newly added ESXi server. This refresh happens every 4 hours. After the next refresh, the new ESXi servers version will be included and accounted for on the update page.	Not applicable
AS-108946	SAN	Data Service may restart when host does not issue abort to timed out command	The Data service will wait up to 300 seconds for host response to iSCSI commands. If host does not abort commands that take more than 300 seconds to complete, the Data service will restart.	Not applicable
AS-100197	SAN	Data Service restart during shutting down FC service on the standby controller	During a controller reboot, due to resource contention between new Fibre Channel (FC) connection attempts and shutdown of the FC module, the Data Service on the array may restart unexpectedly.	Not applicable.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-111926	SAN	Poor iSCSI performance seen when minimum connection count is used	The NCM (Nimble Connection Manager) handles the iSCSI connection counts. Today, the NCM is designed to use a FULL MESH connection mechanism. However, when there are very few initiators and target ports, the total connection count will be minimal. The NCM will default to a minimum of 2 connections per volume. Increasing the number of connections to 4 or more may produce the maximum throughput.	Increase NCMs configuration for minimum number of connections per volume from 2 to 4 or higher.
AS-109412	SAN	NimbleOS services may restart unexpectedly due to slow leak with CHAP logins	Logins to CHAP authentication enabled volumes could leak a small amount of memory the size of CHAP username. Over a period of days and weeks, this leak can result in one or more of the NimbleOS processes running out of memory. As a result, NimbleOS services may restart unexpectedly. The issue is exacerbated by repeated failed login attempts to offline volumes or stale targets.	Identify the offline volumes or stale targets and initiate a host side cleanup/rescan to avoid repeated login attempts and failure to the offline or stale targets.
AS-64790	SAN	Data Service may restart due to race condition	When the Data Service is in process of shutdown, the service may restart due to race condition when shutdown threads do not wait or abort pending operation threads.	Not applicable
AS-98042	SAN	The Data Service restarts unexpectedly during shutdown	When the active controller is being shutdown, the Data Service runs into an internal error condition that causes the service to restart unexpectedly. Since the process is already being shutdown, there is no impact to user data availability.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-101325	SAN	Data Service may restart unexpectedly while removing member array	Under certain conditions, the Data Service on the Group Leader array may restart unexpectedly while removing member array. This is due to a race condition when processing SCSI RTPG (REPORT TARGET PORT GROUPS) commands. The service should stabilize on its own shortly following the restart.	Not applicable
AS-89753	SAN	Service may restart due to race condition	The Data Service or SCSI High Availability Service may restart due to race condition encountered during process shutdown.	Not applicable
AS-103766	System Management	Group Management Service may restart due to race condition	Group Management Service may restart unexpectedly as one thread has taken a ReadWrite lock which has another writer thread, which is waiting for Scale-Out Database (SODB) transaction to be completed. The service restarts due to the SODB transaction exceeding the expected timeout.	Not applicable
AS-110367	System Management	Group Management service may restart due to race condition	A race condition may occur while updating records in the Scale Out database when two threads attempt to update the same record.	Not applicable
AS-54302	System Management	REST API Clone of volume does not support setting ACL at time of clone creation	When created with the REST API, by default the cloned volume inherits the ACL from the parent volume. There is no way to set or change the ACL for the clone at the time of creation through the REST API. Clients should make two REST calls, one to create the clone and then one to change the ACL to the desired value. In the future, we could change the REST API to not set the ACL by default and allow the client to set the ACL at the time of the clone creation to the desired value. This only applies to volumes that have agent_type set to none	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-105431	System Management	Alarm IDs in alarm list may appear out of order.	Due to the multi-threaded nature of the Alerts and Alarms Service, it is possible for an event with a later id to be posted prior to an event with an earlier id. Therefore it will have an earlier timestamp even though its ID is higher. This can cause the IDs to appear out of order. However, the alarms in the list are ordered correctly by timestamp.	Not applicable
AS-99427	System Management	Alarms for Configuration Synchronization may remain after sync has completed	Alarms describing a delayed configuration synchronization to an array may not be cleared properly after an extended network outage and remain active in the GUI.	After confirming that the configuration sync has completed the alarms can be deleted or acknowledged through the GUI.
AS-83604	System Management	Event service may restart unexpectedly	API calls occur between the Event service and Group Management service when an alarm is cleared. The calls will lookup the alarm ID and onset event in the Scale Out Database (SODB). If the alarm is cleared before the onset event lookup completes and is not found during these calls, the service may restart unexpectedly.	Not applicable
AS-94398	System Management	Alarm may not clear as expected	Due to a race condition it is possible for an alarm to remain uncleared on the system even when the alarm condition it is reporting is no longer the case. This can happen if the onset alert and recovery alert were generated at close to the same time.	The problematic alarm can be manually deleted through the CLI command: <code>alarm --delete <alarm_id></code>
AS-87604	System Management	Configuration synchronization recovery alarm is not cleared	An alarm onset should be set prior to discovery request as part of alarm processing. In some cases the discovery request will appear first resulting in the alarm not being cleared.	Clear the alarm manually from the Command Line Interface: 1. Use <code>alarm --list</code> command to determine the alarm ID. 2. Use <code>alarm --delete <ID></code> command to delete the alarm.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-99679	System Management	Eventd process may restart due to exceeding memory limit	The eventd process may restart unexpectedly in systems with larger configurations due to exceeding memory limit. The service will recover after the restart.	Not applicable
AS-85608	System Management	The Event service may restart unexpectedly	The Event service may restart unexpectedly due to a memory access issue. The restart will not impact data connections to the array and the process will recover after the restart.	Not applicable
AS-103567	System Management	Eventd process may restart unexpectedly	The Eventd process may restart unexpectedly due to a rare deadlock condition between its threads. The restart of the process will clear the condition.	Not applicable
AS-50821	System Management	Alerts and Alarms processing service may restart unexpectedly	Alerts and Alarms processing service may restart unexpectedly when certain operation surpass the designated health check timeout. The process will stabilize following the restart.	Not applicable
AS-84502	System Management	Event Service restarts due to memory	Event Service may restart when memory limit is reached. The service will restart to recover from the condition.	Not applicable
AS-46024	System Management	Eventd process may restart intermittently	The Eventd process may infrequently crash, due to a bug in an external library used by the DNS resolver. The restart will not impact data connections to the array and the process will recover after the restart.	Not applicable
AS-72902	System Management	Alerts sent via SMTP may be rejected	When the array sends an alert via SMTP, the message may be rejected by the server indicating 550 5.6.11 SMTPSEND.BareLine-feedsAreIllegal. This can occur if the receiving server does not support BDAT command for SMTP chunking	The recipient can create an inbound transport rule to append a disclaimer to the messages from the problematic sender. The disclaimer will append the expected CR-LF combination to the message so that it can be delivered. (This disclaimer may consist of a single character such as a period or a dash.)

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-110436	System Management	Array Management service may restart unexpectedly	Internal database maintenance processing may exceed the expected health check timeout. When this occurs, the Array Management service may restart to recover from the condition.	Not applicable
AS-71090	System Management	No Audit Log entry is created if user does not have the privilege to create user	If a user tries to create a new user account, but the user does not have the privilege to do so, the user creation will fail. However, an audit log entry is not created.	Not applicable
AS-82919	System Management	Group Management Service restarts due to excessively long username	An excessively long username of over 255 characters will exceed a character limit within the array groups auditing framework. This would cause the Group Management service to restart unexpectedly.	The Group Management service will recover after the crash. The workaround would be to no longer use an excessively long username, and reduce the username to under 255 characters.
AS-96966	System Management	Purge inactive encrypted keys appears in audit log.	Every night, when inactive keys for deleted encrypted volume are deleted by the array, it creates an audit log entry with root as the user performing the action.	Not applicable
AS-116083	System Management	Array Management Service restart	The Array Management Service process may restart after running for a long time due to a memory leak issue. This can cause a short interruption to data service, but it will resume once the process has restarted.	Not applicable
AS-104640	System Management	Group Management Service restarts following volume creation timeout	The Group Management Service on the array may restart unexpectedly when a SOAP timeout is encountered after trying to create a volume. This occurs due to a race condition where the array attempts to delete the volume after the creation attempt fails.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-112416	System Management	GUI performance may be slow for Fibre Channel (FC) arrays with high session count	The GUI relies on REST queries to obtain FC session information. In environments where there are high number of sessions to the array, the queries can take a long time to complete. This will result in slower GUI response for the array.	Contact HPE Nimble Storage Support
AS-109127	System Management	Group Management service may restart when connections to Scale-Out Database exceeds threshold value	Connection to the Scale-Out Database can not be reinitialized when a transaction is in progress. The Group Management Service will restart to restore connection.	Not applicable
AS-112158	System Management	Group Management service may restart during startup	During the startup process for Group Management, key value metadata is loaded from the Scale Out Database (SODB) into memory. The Group Management Service may restart due to exceeding the expected time to complete startup if there is a large amount of metadata to load.	Not applicable
AS-115493	System Management	During a planned shutdown, the Array Management Service may restart	Under certain circumstances, the Array Management Service may detect operations that are still running during a planned shutdown. This may result in an unexpected service restart prior to the array completing shutdown.	Not applicable
AS-99704	System Management	group --status CLI output shows incorrect Failover Mode during network connectivity issues	If there is a network connectivity issue between the witness and Group Leader array, the group status CLI output will update the Failover Mode from Automatic to Manual until the connection is reestablished. It also displays the Witness Status as N/A as opposed to Unreachable.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-94649	System Management	Peer Persistence Automatic Switchover (ASO) is disabled during software update	During software update of array group with Peer Persistence configuration, Automatic Switchover (ASO) is disabled. If an array goes down (both controllers down) during the software update process, due to a power failure or other unexpected event, hosts could lose access to data until the failed array recovers, or a manual switchover of the affected volumes is done.	Not applicable
AS-94683	System Management	Network isolation of the Group Leader and Backup Group Leader array may lead to Automatic Switchover service restarts	In Automatic Switchover environments, in rare instances, network isolation of the Group Leader and Backup Group Leader may cause the service that handles the automatic switchovers to restart unexpectedly.	No workaround is needed. The service recovers on its own.
AS-98953	System Management	Array Management Service restarts during Backup Group Leader discovery	The arrays database system may become unavailable for a limited time when there is a failure in setting up the Backup Group Leader. When attempting to discover a new Backup Group Leader, the Array Management Service may restart due to a race condition.	This restart is non-disruptive to the data on the array, and the Array Management recovers after the restart occurs.
AS-101342	System Management	Group limits command lists internal identifiers	The array group CLI command with limits option (group --list-limits) displays numeric internal identifiers as part of the information listed for the volume information. These numeric identifiers are used by the array only and can be ignored.	Not applicable
AS-104812	System Management	Array Management service restarts due to memory allocation issue	The Array Management service may restart unexpectedly due to an a memory allocation failure when attempting to synchronize configuration with a member array. The restart of the Array Management service clears the situation.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-99702	System Management	Backup Group Leader is not assigned due to power outage	Following a power outage, it is possible that the Backup Group Leader is not assigned to the group. This may occur if the SODB database does not start due to an SSH key issue.	Please contact HPE Nimble Support.
AS-98297	System Management	Array Management service restart due to memory allocation exception	There is a memory leak in the stat (statistics) component of the Array Management service. Magnitude of the memory leak is proportional to the frequency of stats query.	If array is queried for statistics, then its frequency should be reduced. This is specially relevant for the setup where script or some monitoring tool does stats query frequently in a loop.
AS-87749	System Management	Max limit of 120 nics in netconfig alarm does not get cleared	When alarm for number of nics in array net config reaching 120 is triggered, it doesn't get cleared even when the number of nics goes down.	The workaround would be to delete the alarm using the alarm --delete CLI.
AS-93469	System Management	Group Management service may restart while collecting member array statistics	The Group Management service may restart while collecting statistics from member array. This can occur when the request from the group leader to member array exceeds timeout, causing the service to restart to recover.	Not applicable
AS-103275	System Management	Event Service may restart due to invalid database entry	The Event service may restart unexpectedly if an invalid network interface entry is found in the Scale Out Database (SODB).	Contact HPE Nimble Storage Support
AS-92515	System Management	Alarm not cleared after IP address moves to different interface	If an IP address is migrated from one interface port to another, the alarm that was generated indicating the original interface down may not be cleared.	Manually delete the alarm from the command line interface. 1. Login to CLI 2. Find the alarm ID using: alarm --list 3. Delete the alarm using the ID alarm --delete <ID>;

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-73595	System Management	A lossy network causes Group Management service restart	Service threads within the group management API handler are restricted to run for no more than 5 minutes. In a very lossy network, TCP throughput can be throttled to almost nothing due to retransmission timeout back-off. In one observed case, where the API response was about 190 KB, the connection managed to send only about 90 KB before the 5 minute timeout occurred and caused the Group Management service restart.	The only workaround is to improve the quality of the network connection so that the loss of TCP packets is minimized.
AS-112702	System Management	During shutdown the Group Management service may unexpectedly restart	Due to an issue in POCO library, in certain cases, causing the Group Management service to restart. The service restarts to recover from the condition.	Not applicable
AS-74556	System Management	Array Management Service restarted while starting/stopping Group Management Services	Array Management Service may restart unexpectedly when trying to start or stop the Group Management Service. The system recovers automatically after the Array Management Service is restarted	Not applicable
AS-74242	System Management	Force deletion of user defined performance policy should not be supported	There is a --force switch available when deleting a performance policy via the HPE Nimble Storage Array CLI. This --force switch does not work and will fail with the following: ER-ROR: Failed to delete performance policy. Resource busy. The --force command is not supported since the specified performance policy should not be removed without first checking its volume or folder associations.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-101832	System Management	Volume Migration estimates may be inaccurate when multiple volumes are being migrated	Volume move operations copy both data and associated metadata from the source array to destination array. For groups with multi-array pools, copying the metadata can take a significant amount of time, and the estimate calculation may be inaccurate initially. These estimates will auto-correct themselves by using feedback mechanisms.	Not applicable
AS-116625	System Management	Array management service may restart during periods of degraded network connectivity between high available Group Leader and Backup Group Leader arrays.	The Array Management service may restart on a group configured for high availability during various scenarios when Group Leader to Backup Group Leader communication is high or degraded. Scenarios which may cause an array management service restart include degraded network connectivity between GL and BGL arrays.	Not applicable
AS-105041	System Management	Array management service may restart on Group Leader or Backup Group Leader arrays	Array Management service may restart on a group configured for high availability during various scenarios such as when Group Leader to Backup Group Leader communication is at high load or degraded. Scenarios which may cause an array management service restart include degraded or broken network connectivity between GL and BGL arrays.	Not applicable
AS-97697	System Management	Group Management Service may restart unexpectedly	Group Management service may restart due to health check timeout exceeded. The service will recover after the restart.	Not applicable
AS-97327	System Management	Group Management service may restart due to communication timeout exceeded	If communication between Group Management and Postgres services does not complete within expected timeout, the Group Management service may restart. The restart will resume the communication and try the transaction again.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-94835	System Management	Array Management process may restart during automatic failover	Array Management services may be unavailable for a short time due to restart during automatic failover.	Not applicable
AS-101420	System Management	Array Management Service restarts unexpectedly under high load	The Array Management service may restart unexpectedly when the array is under high workload.	The service will stabilize on its own following the restarting.
AS-108145	System Management	Group Management Service may restart due to internal database handling	When a new internal database connection is established, a number of prepared_statements are executed at the beginning. If one of the prepared_statements fails the Group Management Service will restart.	Not applicable
AS-66341	System Management	Group Management Service restarts unexpectedly following automatic Group Leader Failover	The Group Management Service may restart unexpectedly when the array is under heavy load, has many snapshots scheduled, has performed a group merge in the past, and has recently performed an automatic Group Leader Failover.	Not applicable
AS-65676	System Management	Group Management service may restart due to internal database timeout	The Group Management service may restart unexpectedly when internal database query does not complete within the expected time out. The service restarts to clear the condition.	Not applicable
AS-98434	System Management	After group leader migration, quorum is not removed after witness disconnection	After Group migration is performed, backup group leader becomes group leader. If witness is disconnected for more than five minutes, the new leader will not remove quorum.	Disable automatic failover and remove witness from configuration.
AS-106490	System Management	Group management service may restart due to race condition	While syncing the config changes on the downstream array, group management service may restart due to a race condition between protection policy deletion and adding the volume to the protection policy.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-113950	System Management	Group management service may restart due to assertion failure	Group management service may restart due to the race condition between branch creation for the replica volume and replica volume deletion. This race condition will cause an assertion failure and lead to Group Management service restart. This may impact management workflows.	Not applicable
AS-99520	System Management	Both upstream and downstream may claim the volume collection ownership when excessive handovers are performed	If a user performs multiple volume collection handovers between two arrays during a short time span, this may cause a situation where both upstream and downstream array may claim volume collection ownership. This is due to a race condition in the workflow.	Not applicable
AS-73432	System Management	Snapshots display as replicated in GUI on array with no replication configured	Snapshots may display in GUI as replicated snapshots when they are not involved in replication.	Contact HPE Nimble Storage Support
AS-89124	System Management	Synchronous Replication Volume Count Limit	The group --list_limits CLI command does not list the Synchronous Replication volume count Limit. Synchronous Replication on 5.1.0.0 and later can protect up to 128 volumes.	Not applicable
AS-88308	System Management	Cloud Volumes replication does not support group merge	If two on-premise array groups configured with a Nimble Cloud Volumes (NCV) partner are merged, the Cloud Volume replication will stop working.	Not applicable
AS-98650	System Management	Alert for aborted handover does not specify reason	In the case where the downstream array is reaching its snapshot rate limit and the user performs the volume collection handover, the handover will be abort if the limit is surpassed. An alert will be raised but the alert message may be missing the reason for aborting handover.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-98378	System Management	Error No message received after issuing CLI command to disassociate volume from collection	Under system busy conditions, when an excessive amount of operations are being issued in parallel or too many internal retries are occurring to perform tasks, you may receive a No message received error after issuing a CLI command.	Please reissue the command. If the operation was already performed by the earlier command, an appropriate message will be returned.
AS-90649	System Management	Configuration of deduplication volumes for sync replication might fail	If the Default Deduplication setting differs for upstream and downstream pools, the configuration of deduplication volumes for replication might fail with the following error Deduplication not allowed since no application category is assigned to the performance policy	Update the downstream pools Deduplication setting to match the upstream pool.
AS-90286	System Management	volcoll --info output lacks pool/folder qualifications for associated volumes	For the volcoll --info output for sync replication volume collections, the Associated volumes: and Associated pinned volumes: fields lack pool/folder qualification for the associated volumes.	vol --list can be used to determine pool/folder attributes of these volumes.
AS-57574	System Management	Replication of dedupe and encrypted volumes will stall between 3.4 and previous 3.x releases	Encrypted and deduped volumes cannot be replicated from 3.4.x and later to previous 3.x releases because they do not support encryption and dedupe at the same time. Note that this does not affect replication from 3.4.x and later to 2.3.x where the volumes will not be deduped on the downstream running 2.3.x.	Update the downstream array to NimbleOS 3.4.x or later.
AS-49720	System Management	Group Management Service may restart due to race condition	The Group Management service may restart due to a race condition between threads when updating replication records in Scale Out Database (SODB). The service restarts to clear the condition.	Not applicable
AS-81209	System Management	Group Management service may restart due to race condition	In rare occurrences, the Group Management may restart when a race occurs between threads that are disassociating a volume from a volume collection and modifying a schedule for the same collection. The service restarts to recover.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-90633	System Management	Error No message received after issuing CLI command to associate volume to volume collection	Under system busy conditions, when an excessive amount of operations are being issued in parallel or too many internal retries are occurring to perform tasks, you may receive a No message received error after issuing a CLI command.	Please reissue the command. If the operation was already performed by the earlier command, an appropriate message will be returned.
AS-108119	System Management	Group management service may restart due to race condition	The Group Management service may restart due to a race condition between replication commands and group management service restart. The service restarts to recover from the condition.	Not applicable
AS-98155	System Management	Group management service may restart unexpectedly	Arrays with volumes that have large branch structures may cause internal command processing timeout to be exceeded. This will cause the Group Management service to restart due to health check failure.	Contact HPE Nimble Storage Support.
AS-96241	System Management	Group Management service may restart due to high memory usage	When the system has a high number of objects, the Group Management service may restart while running REST query or CLI command.	Not applicable
AS-59470	System Management	Group management process may restart due to a deadlock when replicating	A deadlock can occur between two management processes when updating the replication bandwidth throttle. The Management Process will restart and clear the condition. There is no disruption to data services and replication will continue automatically without intervention.	Not applicable
AS-114179	System Management	Group Management service may restart during process shutdown due to race condition	During shutdown of the group management process, the SSL library logging of the debug messages can cause a race condition, resulting in a segmentation violation error. The service restarts to recover from the condition.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-108765	System Management	Group Management service restarts during the array shutdown	During a planned array shutdown, the Group Management service may restart due a race condition. There is no data or management interruption since the service is already shutting down.	Not applicable
AS-95610	System Management	Group Management Service restarts during bulk volume update	Due to a rare race condition, the Group Management Service may restart unexpectedly during a bulk volume update operation.	Retry the command for the failed volumes.
AS-91638	System Management	Group Management Service restarts due to packet loss in network	If the network response to a REST request takes more than 5 minutes, a thread performing the REST request times out and as a result Group Management Service restarts. The service stabilizes itself and as long as the network is serving the requests faster. A single instance of the Group Management service restart should not cause any disruptions.	Please review the network and see if there is a consistent packet loss and fix any network glitches. If you need any assistance, please reach out to HPE Nimble Storage Support.
AS-108868	System Management	Group Management service may restart while collecting user information from Active Directory	In environments with an array integrated with Active Directory, the create/validate session code holds a lock on an underlying sessions table and then goes to Active Directory to collect more information about the user. If this operation takes too long, the Group Management service may timeout to free this lock.	Confirm all Domain Controllers in the Active Directory environment that is integrated with the array are reachable.
AS-66182	System Management	Discovering volumes after array resetup may cause Group Data service restart	If a user runs --resetup followed by setup on an array that was previously configured and setup does not complete successfully, data IPs may be unconfigured until the setup actually completes successfully. As a result, GDD may restart unexpectedly if any attempts are made to discover the volumes on those unconfigured data IPs.	Ensure setup completes successfully before attempting to discover volumes.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-105944	System Management	Time to Live (TTL) expiry date on last replicated snapshots can be negative	NimbleOS protects the last replicated collection, in some cases, the TTL expiry date on those snapshots can become negative when the snapshots exist beyond TTL.	The TTL can be updated on the snapshots which have a negative value to a current value. The snapshot may also be removed if it has been confirmed it is no longer needed.
AS-93113	System Management	Unmanaged snapshots remain after cleanup is enabled	If clones are created using an unmanaged snapshot, then this unmanaged snapshot will not be deleted even if cleanup is enabled.	Not applicable
AS-95868	System Management	Group Management service may restart due to internal database timeout	The Group Management performs queries on the information stored in the Scale Out Database (SODB) for the array. If the query does not complete within the expected timeframe, the service may restart to recover from the issue.	Not applicable
AS-97899	System Management	Group Management service may restart due to communication timeout exceeded	If communication between Group Management and Postgres services does not complete within expected timeout, the Group Management service may restart. The restart will resume the communication and try the transaction again.	Not applicable
AS-68782	System Management	System limitation of writable snapshots is not reported by NimbleOS	The group --list_limits CLI command does not list system limitation for writable snapshots. Also, no alerts or alarms are generated as the array group approaches the limit.	Please refer to the System Limits and Timeout Values section in the NimbleOS Administration Guide.
AS-94517	System Management	Group Management service may restart due to memory exhaustion	Group Management service may restart due to memory exhaustion in configurations that approach 10,000 volumes and 300,000 snapshots.	Not applicable
AS-65935	System Management	Frequent, multiple Snapshot Collection deletions causes GUI to hang	Multiple snapshot deletions can be deleted in a single request. Back-to-back deletions of multiple batches of ten or more snapshot collections may cause the HPE Nimble Storage array GUI interface to hang.	Refresh the HPE Nimble Storage array GUI .

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-23891	System Management	Changing replication partner in a volume collection with multiple schedules reports the following error: The request could not be processed by the server	A volume collection can currently replicate to only one replication partner. In case of multiple schedules in a volume collection, editing single protection schedule to different replication partner violates this constraint.	Set downstream partner on all schedules in the volume collection to none and thereafter change replication partner on desired schedules to the new partner.
AS-104965	System Management	Group Management service may restart during array shutdown	During planned service stop, such as array shutdown, the Group Management service may restart due to a race condition. There is no data or management interruption since the service is already shutting down.	Not applicable
AS-62192	System Management	Group Management service may restart unexpectedly due to a conflict with internal threads	When internal threads encounter a locking conflict, the Group Management service may restart to recover from the condition.	Not applicable
AS-115819	System Management	System Processes or Systems may start slowly after over temperature restart	After a controller restarts due to over temperature condition, System Management processes may restart and take longer to start up due to slow system performance.	Not applicable
AS-108378	System Management	Array management service may restart during periods of degraded network connectivity between Group Leader and Backup Group Leader arrays.	Array Management service may restart on a group configured for high availability during various scenarios when Group Leader to Backup Group Leader communication is high or degraded. Scenarios which may cause an array management service restart include degraded or lost network connectivity between GL and BGL arrays.	Not applicable
AS-103982	System Management	Group Management Service may restart unexpectedly due to network connectivity	In rare instances, the Group Management Service may restart unexpectedly when the Group Leader and Member array have lost connectivity due to network outage. The service restart recovers GUI and CLI access, data services are not impacted by the restart.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-105453	System Management	Group Management service may restart unexpectedly	The Group Management service may restart when service communication for internal database processing is terminated. The service restarts to restore connections between the services.	Not applicable
AS-95132	System Management	Process Management service may restart during software upgrade	In rare instances, the Process Management service restart may occur during software update. The system recovers after the restart of the service.	Not applicable
AS-98504	System Management	Group Management service may restart unexpectedly	If internal database processing for array statistics exceeds the expected timeout, the Group Management service will restart due to health check failure to recover.	Not applicable
AS-113375	System Management	Automatic Failover Backup Group Leader demote may be delayed in rare circumstances	Automatic Failover demotion of a Backup Group Leader array may be delayed for multiple minutes when an internal database is performing weekly garbage collection. The Group Leader is not able to demote the Backup Group leader during a weekly window when an internal database is performing internal garbage collection. This may last for multiple minutes. Eventually Backup Group Leader demote succeeds, and a new Backup Group Leader is selected. The Group loses High Availability during this time and the Group Management service may restart to recover from the condition.	Not applicable
AS-101392	System Management	Services may not start on the array after it is powered on and off several times	When the array is powered on and off excessively, services may fail to start on the array.	Please contact HPE Nimble Storage Support
AS-99615	System Management	Array Management Service restarts unexpectedly following automatic Group Leader Failover	The Array Management Service restarts unexpectedly following automatic Group Leader Failover (AFO). The restart is non-disruptive.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-105804	System Management	Group Management service may restart unexpectedly when performing high snapshot activity	Group Management service may restart on the array when there is a high amount of snapshot activity being performed. The service restart will recover from the condition and the snapshot operations will resume.	Scheduling snapshots to occur at different times instead of all at once may help alleviate this issue.
AS-110374	System Management	Group Data Service may restart when the array is under heavy load during software update	The underlying scale-out database competes with CASL and other system processes for IOPS. During software update, a migration script runs against the database. Under heavy file system load, the migration steps may not complete within the expected amount of time. As a result, the migration may time-out leading to a restart of the Group Data Service. After the restart, the migration should complete as normal without any user impact or intervention.	No workaround available. To avoid encountering this issue, reduce IO load when performing software update. Software Update will succeed after one or more System Management service restarts.
AS-98694	System Management	Snapshot limit warning alarms persist after update to 5.1.x.x or later	After the update to 5.1.x.x or later, the Snapshot limit warning alarm is no longer used. This presents a situation where stale alarms are present on the array and they will not be cleared even if the space situation is rectified. The alarm follows the following format: WARNING Mon DD YYYY HH:MM:SS Acknowledged - Volume <volume name>; snapshot space usage is over the configured warning limit.	The alarms can be deleted manually either in the GUI or on the CLI.
AS-77045	System Management	Alarm not cleared after volume or pool drops below warning threshold	Alarms are generated on the array when volume or pools exceed thresholds. In some instances the recovery event to clear the alarm when the condition is cleared does not clear the alarm.	Confirm the usage level for volume or pool indicated by the alarm is below threshold. Once confirmed usage level is below threshold, clear the alarm from the Command Line Interface (CLI): 1. List the alarms to find the alert ID alarm --list 2. Delete the alarm that is no longer valid alarm --delete

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-110123	System Management	Group Management service may become unavailable when shut down	Infrequently the Group Management service may encounter an error while shutting down. If the service is being restarted it may take a few more seconds to start. GUI and CLI will be unavailable for a few seconds.	Not applicable
AS-108432	System Management	Group management service may restart when there are many REST requests for volume statistics values	High concurrent REST volume reads with statistics may cause Group Management service to restart. Current REST requests will fail, GUI and CLI will be unavailable. The system will recover after the restart of the service.	Not applicable
AS-106848	System Management	Arrays with Automatic Switchover enabled fail software update with generic message	Software updates to 5.1.4.200 are not allowed when Automatic Switchover (ASO) is configured. If a software update to 5.1.4.200 fails for this reason, a generic software update failure message is returned in the GUI. The cause of the failure would need to be determined by looking at the system configuration and determining if ASO is configured.	The ASO checkbox is enabled by default, however ASO is not enabled until a witness has been configured. In the GUI, navigate to Administration > Availability. If witness is configured and the ASO check box is checked, disable ASO by unchecking the box and clicking save. Perform the array software update again. If the update continues to fail with generic messaging, contact HPE Nimble Support.
AS-57173	System Management	Updating array groups from earlier NimbleOS 3.x releases to 3.3.x or later releases could timeout	Due to the number of firmware updates involved, software update going from pre-3.3.x versions to 3.3.x or later could take too long and eventually timeout. These update times may take longer in larger multi-array group configurations. Software update in smaller array groups should complete without intervention.	If a timeout occurs, the update can be completed using the software <code>--resume_update</code> command.
AS-54519	System Management	Software update inactivity timeout messaging	When a software update is initiated on the array and the prompt for EULA acceptance is not answered, the software update session will timeout after several hours with a message indicating Requires Authentication or Contact HPE Nimble Storage Support.	Initiate the software update again and answer the EULA prompt and the software update will proceed as expected.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-40516	System Management	Timeouts during software update	Under rare conditions, a software update may report an error even though the actual update has completed successfully. This occurs when software update takes longer than 4 hours.	Running the software <code>--resume_update</code> command from the console will clear this condition.
AS-72559	System Management	Group management service may restart during software update	Group management service may restart during software update due to race condition involving unlocking the download lock file.	Not applicable
AS-66997	System Management	Health check timeout may cause software update failure	The timing is close enough that it is possible for the individual array precheck during software update to take long enough that the health check timeout is triggered, causing the group management process to restart and the software update to fail.	This is an intermittent issue, so if the software update fails in this manner it should pass if the software update is resumed.
AS-91962	System Management	Volume management operations may fail with unrelated error messages while handover is in-progress	While the volume ownership is being changed, any management operation involving that volume could fail. This is expected behavior. Depending on the progress of that handover operation, management operation is failing with different errors.	Ignore the error message and retry the management operation
AS-105035	System Management	Group Management service may crash while trying to create users while array is under heavy load	In rare instances, if the array is under heavy load and Group Management service restarts while new user is being created, the service can fail to start.	Contact HPE Nimble Storage Support
AS-107491	System Management	Active Directory authentication may fail with Read-Only Domain Controller (RODC)	Array authentication to an Active Directory Read-Only Domain Controller (RODC) may fail, resulting in failures to authenticate Active Directory users.	Add the computer account credentials for the array by adding it to the RODCs password replication policy (PRP) under the Allowed RODC Password Replication Group group.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-111166	System Management	Active Directory connection failures	The expected configuration isn't loaded when the Active Directory integration service starts, leading to failed logins or inconsistent Active Directory connectivity in certain configurations.	As a local admin on the array, restart the Active Directory integration service by disabling and enabling the integration. Via the GUI: Navigate to Administration > Security > Microsoft Active Directory Click Disable Click Enable Via the CLI: <code>userauth --disable &lt;domain></code> ; <code>userauth --enable &lt;domain></code> ;
AS-109805	System Management	Group Management service may restart due to health check timeout	The Group Management service may restart when internal database processing exceeds the expected timeout value. The service restarts to recover from the condition.	Not applicable
AS-113885	System Management	 Group Management service may restart while collecting user information from Active Directory	In environments with an array integrated with Active Directory, the create/validate session code holds a lock on an underlying sessions table and then goes to Active Directory to collect more information about the user. If this operation takes too long, the Group Management service may timeout to free this lock.	Confirm all Domain Controllers in the Active Directory environment that is integrated with the array are reachable.
AS-95212	System Management	HPE Nimble Storage array compatibility issues with MIT Kerberos trust types	When the HPE Nimble Storage array is configured to use Active Directory integration, the array is joined to one specific domain, as a domain member. Under normal circumstances, users in trusted domains will also be able to authenticate to the array. If one or more trusted domains are joined to the forest using an MIT Kerberos type trust relationship, users and groups in any trusted domain (e.g. not the domain the array is joined to) will be unable to authenticate to the array.	Not applicable
AS-72869	System Management	Group Management Service may restart due to internal database handling	The Group Management service validates session information in the Scale Out Database. If the validation exceeds the expected timeout, the service will restart to recover.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-71137	System Management	Group Management Service restarts while authenticating AD users	The Group Management Service may restart unexpectedly if it takes longer than 300 seconds to authenticate an Active Directory (AD) user.	Not applicable
AS-74830	System Management	Group Management service may restart when joining array to Active Directory	When joining Active Directory via GUI or userauth command in CLI, the command is expected to complete within 300 seconds. If this timeout is exceeded during the process, the Group Management service will restart to recover.	Not applicable
AS-69084	System Management	Group Management service may restart while collecting user information from Active Directory	If collection of user group information from Active Directory takes longer than expected, the Group Management service timeout may be exceeded. The service will restart to resume information collection.	Not applicable
AS-104512	System Management	Active Directory authentication in some cases, may lead to a Group Management service restart	Active Directory Authentication causes the arrays Group management service to wait for a response from the Active Directory. If this response is delayed, the Group Management Service may restart unexpectedly.	Not applicable
AS-115002	System Management	Group Management service may restart due to healthcheck timeout	The Group Management service may restart when user lookup is in process and the winbindd service does not respond within the expected timeframe. The service restarts to recover from the condition.	Not applicable
AS-102893	System Management	Enabling synchronous replication fails upon reaching volume limit	Following operations will fail upon reaching the volume limit: -adding Synchronous replication schedule to a volume collection -associating a volume to a volume collection with Synchronous Replication enabled - editing a Volume Collection schedule to add Synchronous Replication partner	Delete unused clones or volumes to bring down the volume count.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-84276	System Management	Performance issues for volumes created when array was running NimbleOS versions 1.3.x and earlier	After updating to NimbleOS 4.x, volumes initially created when an array was running NimbleOS 1.3.x and earlier may experience a negative impact on performance. This is caused by software changes made to the compression algorithm used by these older volumes.	Please contact HPE Nimble Storage Support to update the compression algorithms of these older volumes.
AS-101535	System Management	Group Management Service is temporarily unavailable after deleting volumes	Enabling and disabling the dedupe setting on volumes and concurrently deleting volumes can cause the Group Management Services to become temporarily unavailable on the array.	The Group Management Service will eventually restart itself
AS-86545	System Management	Unable to create dedupe enabled volumes on a new install	After a CSx000 array is installed, it takes one minute for the array to determine its deduplication capability. If a volume is created prior to this, it will not have dedupe enabled even if the array is dedupe capable.	Once the array is able to determine its deduplication capability, all newly created volumes will have dedupe enabled, if specified. In order to enable dedupe on the previously created volumes, you may run the following command via the HPE Nimble Storage Array CLI: <code>vol --edit &lt;vol_name>; --dedupe_enabled yes</code>
AS-92157	System Management	No CLI support for changing the Witness Port	Currently, there is no CLI support for changing the witness port. The <code>nimble-witnessd.service</code> file needs to be edited manually.	Not applicable
AS-100067	System Management	Member array might not be displayed under Add Array to Group option	A member array might not be listed under the Add Array to Group option within the GUI if the member is configured with a different protocol (iSCSI vs Fibre Channel). Also when there are multiple arrays in the subnet, arrays which cant be discovered within the stipulated time may not be listed in Add Array to Group.	Not applicable
AS-107015	System Management	Group Data service may restart on startup	In rare instances, the Group Data service may restart during startup due to a misconfiguration in NimbleOS pertaining to a file descriptor limit.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-99431	System Management	Array Management Service restarts or Takeover occurs unexpectedly following automatic Group Leader Failover	In rare circumstances, following an Automatic Failover (AFO) a race condition may cause the Array Management Service to restart or an unexpected controller takeover.	Not applicable
AS-99343	System Management	Custom SSL certificate import not supported on older versions of Google Chrome	Within the HPE Nimble Storage array GUI, custom SSL certificate import is only supported on Google Chrome version 71 or later.	Not applicable
AS-98177	System Management	Setting alarm reminder frequency to the same value from GUI does not change next reminder time	When updating an alarm from the Events & Alarms page in GUI, selecting an alarm and clicking CHANGE REMINDER button, without changing the reminder frequency time, and clicking SAVE button, does not change next reminder time. This behavior is different from CLI. Setting alarm reminder frequency to the same value from CLI resets the next reminder time based on the current time.	To keep the same reminder frequency and reset the next reminder time based on the current time, change the reminder frequency to a different value, save it, and change it back and save it, or use CLI to make the change.
AS-87701	System Management	Incorrect information on hardware page displayed when controller is down	When a controller is down, the user may see incorrect representation of physical ports within the Hardware Page of the array GUI. This is due to the lack of information from the missing controller.	When the controller is back up, all the information is displayed correctly on hardware page.
AS-7199	System Management	Selecting event filters can hang the GUI	If an extremely large number of events exist, selecting filters can hang the GUI and consume a large amount of memory.	Not applicable
AS-102299	System Management	GUI Error when entering a valid folder overdraft limit value	The Array GUI incorrectly returns an error when a valid value for the folder overdraft limit has been entered. This happens only in Internet Explorer and Microsoft Edge browsers.	Use Google Chrome or Mozilla Firefox browser.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-77372	System Management	Group Merge via GUI unable to process large amount of conflicts	Currently within the HPE Nimble Storage Array GUI, when performing a group merge, if there is a large amount of group merge conflicts (1000 or more), the GUI is unable to process and resolve all of them.	To work around this issue: 1. Log into the destination array to resolve the conflicts. 2. Attempt the group merge again.
AS-87886	System Management	GUI may show Successful message when group merge fails	During group merge, the GUI might show Successful message even though the group merge backend processing fails.	Not applicable
AS-94575	System Management	Unable to edit a storage pool and assign an array at the same time	When attempting to edit a storage pool and assign an array at the same time, you receive the following error: Cannot update array list and name or description simultaneously.	Edit the pool name and assign / un-assign the array a in separate steps.
AS-95591	System Management	Incorrect ordering of pool merge error messages when Synchronous Replication and Witness are configured	Pool merge is not allowed if Synchronous Replication is enabled and pool merge is not allowed when a witness configured. If an array group has a witness configured for Automatic Switchover and has Synchronous Replication configured, when a user tries to perform a pool merge, the following error is generated: "pool merge is not allowed when witness is configured". In this case, if the user removes the witness and then re-attempts the pool merge, the following error is then generated: "Pool merge is not allowed when involved in sync replication". This error should supersede the previous error.	Not applicable
AS-104099	System Management	Volume collection association for a volume can fail due to a name conflict on the downstream array	When associating multiple volumes to a volume collection from, the volume association for all volumes can fail due to a name conflict for one of the volumes on the downstream.	Fix the name conflict on the downstream array.
AS-48847	System Management	Browser throws a web server communication error	When the GUI runs for a long time, the browser may encounter an out of memory issue.	If the page hangs or throws a web server communication error, try to clean the cache and refresh. If the problem persists, restart the browser.

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-93157	System Management	Array GUI does not specify which snapshots are unmanaged	The Array GUI does not specify which snapshots are unmanaged and no longer belong to a volume collection.	Run the following command via CLI: <code>snap --list --all --unmanaged</code>
AS-67289	System Management	In the Create Replication Partner wizard the inbound location is no longer automatically populated	In the Create Replication Partner wizard, the Inbound Location is no longer automatically populated.	Click the dropdown arrow and select a location from the pool and folder navigation tree.
AS-99024	System Management	Browser becomes unstable upon certificate change	After changing a certificate, the GUI may present an error such as follows: The web service is very slow or unreachable...	After a new custom certificate has been imported or existing certificate is deleted, please close the browser where the action was performed and reopen a new one to guarantee a new connection request to the NimbleOS web interface.
AS-92634	System Management	Volume performance numbers may report invalid values after software update	The volume performance numbers displayed in the GUI under Manage > Data Storage > Volumes > Performance Tab may display invalid values temporarily after an array software update.	The values should report correctly within 24 hours after the update has completed.
AS-104567	System Internals	Array Management Service restarts when Group Leader cannot reach Backup Group Leader	When the Group Leader attempts to complete the Backup Group Leader promotion, if there is not a healthy data path, the Backup Group Leader promotion fails. Despite, the network error, the Backup Group Leader promotion goes into a loop and ultimately leads to an unexpected restart of the Array Management Service.	Not applicable

Known Issues in NimbleOS version 5.3.1.100

ID	Component	Title	Description	Workaround
AS-86901	System Internals	Group Data Service may restart when the array is under heavy load during software update	The underlying scale-out database competes with CASL and other system processes for IOPS. During software update, a migration script runs against the database. Under heavy file system load, the migration steps may not complete within the expected amount of time. As a result, the migration may time-out leading to a restart of the Group Data Service. After the restart, the migration should eventually complete as normal without any user impact or intervention.	There is no workaround. To avoid encountering this issue, reduce IO load when performing software update.
AS-80445	System Internals	File System service may restart during array shutdown	The File System service may restart during array shutdown if it exceeds expected time to shutdown. The service restarts to clear the condition.	Not applicable
AS-69561	System Internals	Data Service can restart unexpectedly during shutdown process	Due to a race condition, the Data Service can crash during a graceful shutdown causing unexpected Data Services restart messages to be generated. This should not cause any I/O impact because the Data Service is already in the process of shutting down.	Not applicable
AS-49046	System Internals	Data Service may restart when the array runs out of scratch pages	Under unique customer workloads, the index footprint may exhaust default scratch page allocation in memory. As a result, the Data Service may restart unexpectedly.	Please contact Nimble Storage Support to increase the scratch page pool size.
